



# TARADCOM LABORATORY TECHNICAL REPORT

NO. 12304

ESTABLISHMENT OF ULTRASONIC INCLUSION RATING METHOD FOR TORSION BAR SPRING



AUGUST, 1977

APPROVED FOR PUBLIC RELEASE; DISTRIBUTION UNLIMITED


by\_

Clarence J. Carter & Raymond A. Cellitti

International Harvester Co. Manufacturing Research

Contract No. DAAE07-75-C-0088

U.S. ARMY TANK-AUTOMOTIVE RESEARCH AND DEVELOPMENT COMMAND Warren, Michigan 48090

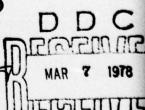

A



Technical Report No. 12304

Establishment of Ultrasonic Inclusion Rating Method for Torsion Bar Spring

Ву

Clarence J. Carter Raymond A. Cellitti

11 Aug 977

13 48P.

75 DARE 97-75-C-4088

18 TARADCOM

19/123/14

U.S. Army Tank - Automotive
Research and Development Command
Warren, Michigan 48090

D D C D P CO P CO T T P I S MAR 7 1978

1 International Harvester Company

3 Manufacturing Research

2 Hinsdale, Illinois 60521

new 410 588

DISTRIBUTION STATEMENT A

Approved for public release; Distribution Unlimited


503

#### FOREWORD

This final technical report covers work performed under Contract DAAE07-75-C-0088 entitled "Establishment of Ultrasonic Inclusion Rating Method for Torsion Bar Spring."

The project was initiated under Materials Testing Technology Program and administered by Mr. Kazys Navasaitis of Material Application and Technology, U.S. Army Tank - Automotive Research and Development Command, Warren, Michigan.

Project activities were under the technical supervision of R. A. Cellitti, Manager, Metallurgical Research. Other areas of technical responsibility were provided by J. A. Harlan, Research Metallurgist and C. J. Carter, Research Associate.

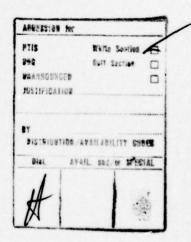

#### ABSTRACT

Torsion spring material steel billets of 8660 and 51B60 were ultrasonically evaluated and graded for internal cleanliness. The billets were rolled to bar stock (2-5/8 inch diameter) reinspected ultrasonically and processed into torsion bars (P/N 7359890) for subsequent testing at TARADCOM. Standard test specimens were prepared and tested from bar and billet stock. Tension tests indicated that reduction (>2:1) in ductility occurred with 8660 billets containing inclusion areas of ultrasonic signature No. 10. Inclusion area of 8660 bar stock (6.6:1 reduction from billet cross section) showed a 1.25:1 reduction in ductility for inclusion areas of category 10. Billet material of 51B60 indicated a 7:1 reduction in ductility for category 10 inclusion and bar stock indicated a 2:1 average reduction of ductility. Torsion test of specimens from billet stock for both alloy grades indicated susceptibility to crack occurrence from internal defects. Torsion yield strength of 51B60 showed a decline of 17.5% between extreme cleanliness grades. No difference in torsion yield strength was noted with 8660 bar stock which is attributed to a higher degree of ductility at high cleanliness severity levels. Fracture toughness (K<sub>IC</sub>) was comparable for both alloy grades. Ultrasonic category 10 is equivalent to  $2 \times 10^{-5}$  in<sup>2</sup>.

#### TABLE OF CONTENTS

INTROD	UCTION	4				1
	I,	Objective				2
	11.	Material				2
	111.	Ultrasonic	Inspection			4
	IV.	Ultrasonic	Test Results			6
	v.	Mechanical	Properties			7
Conclu	sions					11
Recomm	endat:	ions				12
Distri	butio	n List				38

#### LIST OF FIGURES

Figure		Page
1	Zones and Method of Ultrasonic Inspection Coverage for 6" x 6" Billets	13
2	Computer Print-out of Defect Magnitude, Count and Calculated Cleanliness Index Rating	14
3	Support Fixture for Rotating Torsion Bar Stock in Ultrasonic Immersion Tank	15
4	Internal Defect Located Ultrasonically in Billet and Subsequently Machined to Position Defect Near the Surface	16
5	Fractured Torsion Bar Specimens	17
6	Sites of Surface Cracks which Propagated from Internal Defects Located Ultrasonically in Billet Stock	18
7	Sites of Surface Cracks which Propagated from Internal Defects Located Ultrasonically	19
8	Automated Computerized Ultrasonic Cleanliness Rating System	20
9	Ultrasonic Inclusion Category Versus Inclusion Area as Measured by Light Microscopy	21

#### LIST OF TABLES

Table		Page
1	Ultrasonic Cleanliness Rating (Grade Level) of 6 in. x 6 in. Billet Mult Lengths, 8660	22
11	Ultrasonic Cleanliness Rating (Grade Level) of 6 in. x 6 in. Billet Mult Lengths, 8660	23
111	Ultrasonic Cleanliness Rating (Grade Level) of 6 in. x 6 in. Billet Mult Lengths, 51B60	24
IV	Ultrasonic Cleanliness Rating (Grade Level) of 6 in. x 6 in. Billet Mult Lengths, 51B60	25
v	Ultrasonic Cleanliness Rating (Grade Level) of 6 in. x 6 in. Billet Mult Lengths, 51B60	26
VI	Bar Stock (2-5/8 inch Dia.) Machined From 6 inch x 6 inch Billets (8660 & 51B60)	27
VII	Ultrasonic Rating (Grade Level) of 2-5/8 Inch Diameter Rolled Bars (8660 & 51B60)	28
VIII	Tension Properties (0.505 inch Dia. Specimen) Sectioned From 6 in. x 6 in. Billets, 8660	29
Xi	Tension Properties (0.505 inch Dia. Specimen) Sectioned From 2-5/8 Inch Dia. Bar, 8660	30
x	Tension Properties (0.505 Inch. Dia. Specimen) Sectioned from 6 in. x 6 in. Billets, 51B60	31
XI	Tension Properties (0.505 Inch Dia. Specimen) Sectioned from 2-5/8 Inch Dia. Bar, 51B60	32
XII	Static Torsion Strength Of Billet Stock (6" x 6"), 8660	33
XIII	Static Torsion Strength Of Bar Stock (2-5/8 Inch Dia.), 8660	34
XIV	Static Torsion Strength Of Billet Stock (6" x 6"), 51B60	35
xv	Static Torsion Strength Of Bar Stock (2-5/8 In. Dia.), 51B60	36
xvı	Room Temperature Fracture Toughness (KIC) As Measured By FCSG Charpy Specimens, 8660	37
XVII	Room Temperature Fracture Toughness As Measured By FCSG Charpy Specimens, 51B60	38

#### INTRODUCTION

The classification of defects and acceptable quality level of straight, solid circular cross-section torsion bar springs and materials from which processed bars are inspected by visual methods include magnetic particle inspection. While visual inspection of surface and near surface discontinuities may afford suitable inspectional controls when applied to large defects and discontinuities, small indications which go undetected are crack initiation sources which may grow to critical sizes under service conditions resulting in premature fracture of the structure.

The ultrasonic inspection approach to evaluating and rating material quality has been successfully utilized as a supplemental method by steel producers and consumers for reliable quality assessment of raw material and end item structures. By coupling the ultrasonic detection unit with rapid electronic data processing equipment, an accurate and reliable quality rating system capable of detecting small defects is provided.

This program was concerned with a study in which (1) an automatic computerized ultrasonic rating system was utilized to inspect and rate internal cleanliness quality of semi-finished material (6" x 6", 15.24 cm x 15.24 cm cross-section billets) from which torsion bars were subsequently processed and (2) mechanical behavior of heat treated specimen bars representative of various material quality levels was ascertained.

#### I. OBJECTIVES

The primary objective of this study was to ultrasonically evaluate torsion bar material in the semi-finished condition (6" x 6", 15.24 cm x 15.24 cm billet) and rolled-formed bar size (2-5/8", 6.7 cm diameter) to assess and relate the influence of non-metallic inclusion size on engineering properties. A secondary objective was to evaluate a less expensive alloy steel (51B60) as an acceptable alternate in lieu of the alloy steel (8660) currently in use as torsion springs on the M-60 tank. Additionally, the project was concerned with fabrication of 70 torsion bars (P/N 7359890) representative of five cleanliness levels as determined ultrasonically. Thirty-five torsion bars were processed for each alloy and delivered for torsion testing at TARADCOM laboratories. Test specimen blanks (tension, torsion and fcsg Charpy) from bar and billet stock representative of various cleanliness levels were ultrasonically located, machined to a standard configuration and tested.

#### II. MATERIAL

Material for this study was procured in the form of  $6" \times 6"$  billets of 9.6 ft., 2.93 m lengths. The ladle analyses of the alloy steels were as follows:

Designation C P Si Ni Cr B Mn S Mo .59 .88 .016 .028 .26 . 43 . 53 .18 51B60 . 63 .91 .019 .020 .28 .04 .78 .01 .0005 Min

Jominy hardenability tests were also conducted. Jominy bars from both materials were normalized at 1600F (871C) and end-quenched

from an austenization temperature of 1550F (843C). The hardenability results are shown below:

Distance From Quenched End In 1/16"(1.6 mm)	Hardne 8660	ss, Rc 51B60
quenched Bird in 1/10 (1.0 him)	5000	<u> </u>
1	62	62
2	62	62
2 3	61	61
4	61	61
<b>4</b> 5	61	61
6	60	61
7	60	61
8	59	60
10	59	60
12	56	59
14	49	51
16	46	43
20	39	41
24	36	37
28	34	33
32	34	31

Both alloys represented the product of three ingots which were selected (last poured ingots) to obtain a wide range of cleanliness grades.

#### Preparation

All billets were heat treated and surface conditioned (2 opposite and parallel ground surfaces) for optimizing ultrasonic acoustical response. Heat treatment consisted of normalizing at 1600F (871C) for six hours followed by air cooling. Two opposite surfaces were then ground to provide a surface finish of 15 to 84 RMS.

Each billet was identified with a numeric code and marked in preselect segments (mult lengths) of 13 inch (33 cm) lengths.

This mult length corresponded to a subsequent rolled 2-5/8 inch (6.7 cm) diameter bar of 84 inch (2.13m) length. This procedure

was intended to provide a comparison of inclusion magnitude or cleanliness rating between the semi-finished product (billet) and final bar size as determined ultrasonically. Figure 1 illustrates the manner in which the billets were identified and marked for individual inspection of each mult length.

#### III. ULTRASONIC INSPECTION

#### Instrumentation

Ultrasonic inspection was carried out using an automatic computerized ultrasonic cleanliness rating system. The IH cleanliness rating system is not commercially available as an assembled inspection unit. However, the inspection procedure and instrumentation requirements are described in Method B of ASTM E-588. The automatic computerized ultrasonic cleanliness rating system is pictorially shown in Figure 8.

The system detects and counts various size inclusions and internal discontinuities by pulsing a high frequency sound wave through the material. The sound waves are reflected back to a search unit with an intensity level which is related to the inclusion area. The reflected sound waves are converted to electric energy in which voltage is monitored 750 times a second and categorized into 16 separate levels. The computer continuously stores the incoming signals and performs a calculation of cleanliness index rating upon scan termination. The method of computation is as follows:

Cleanliness Index Rating =

 $\sum_{i F_i P_i}$ 

where: F<sub>i</sub> = Frequency of counts (expressed as percent)
for Category i

P<sub>i</sub> = Progression factor for Category i

The progression or weighting factor (Pi) for category i = 1.62 (i-2).

The search unit or transducer employed was a 5 mhz, lithium sulfate, focused crystal.

#### Calibration

Ultrasonic calibration standards were prepared from both alloy grades which contained 1/64 inch (.40mm) dia. flat-bottom holes. Instrument calibration was effected by positioning the transducer over a (3 inch, 7.6 cm metal travel) flat-bottom hole and adjusting the sensitivity control to obtain a 2 inch (5.1 cm) video amplitude on the cathode ray tube. The highest magnitude counter (category 16) was then adjusted with an interface sensitivity control to respond to a mid-range voltage of 9.70 volts. Each category corresponds to a voltage range of 0.625 volts. The voltage range of category 16 is 9.375 volts to 10.00 volts. The video amplitude is lineally related to the analog (pulser/receiver) output voltage for video amplitudes between 0.2 inch (.51 cm) and 2 inch (5.1 cm). The video amplitude is related to the magnitude of energy reflected from an inclusion and/or defect area.

#### Ultrasonic Inspection Procedure

#### Billets

The billets were scanned parallel to the rolling direction with

lateral indexing of 0.050" (1.3mm). Each mult length was rated separately with gated inspection zones of 2 inch (5.1 cm) depth 1 to 3 inches, (2.54 cm to 7.6 cm) from the top surface). Five separate and adjacent gate widths of 1 inch (2.54 cm) were rated for each mult length as depicted in Figure 1. Figure 2 shows a print-out of data obtained for individual inspection zones.

#### Rolled Bars (2-5/8 inch diameter (6.7 cm) Diameter

A special fixture was constructed to accommodate round bar stock for ultrasonic inspection. The fixture consisted of a drive sleeve which was bolted to one end of the bar diameter. The sleeve was connected by a rubber gear pulley belt to a variable speed drive motor. A similar gear sleeve was attached to the motor drive shaft. The bar was immersed in an ultrasonic tank and supported on roller bearings clamped to cross beams in the tank. The fixture is photographically illustrated in Figure 3. The bar was rotated in position while the transducer traversed the length via a mechanized carriage at a lineal speed of .5 inches/sec. (1.3 cm/sec.).

#### IV. ULTRASONIC TEST RESULTS

#### **Billet**

The inspected material was assigned a cleanliness grade which was cross-referenced with the weighted ultrasonic cleanliness rating index. The five cleanliness grades or levels and associate ultrasonic cleanliness indices are shown below:

Grade	Ultrasonic Cleanliness Index	Remarks
A	0.6 to 1.2	No inclusions were noted in excess
		of category 8. 80% of inclusions
		are less than category 2 level.
В	1.2 to 3.0	No inclusions were noted in excess of
		category 13 and at least 60% of counts
		were below category 2 level.
C	3.0 to 10.0	A small percentage (less than 1) of
		category 16* level inclusions noted.
D	10.0 to 70.0	1% to 5% of category 16 level present.
E	Greater than 70.0	Over 5% of the total number inclu-
		sions scanned occurred in category
		16 or higher.

\*Category 16 is equivalent to a 1/64 inch (.4mm) diameter flat bottom hole.

The ultrasonic inspection results obtained from billet mult lengths are shown in Table I through Table V.

#### Bar

The various ultrasonic grades obtained for the bar stock are shown in Table VI and VII. Figure 4 shows a long subsurface crack which was ultrasonically detected in a billet and subsequently machined to locate the defect near the surface.

#### V. MECHANICAL PROPERTIES

Although a quantity (70) of torsions bars (P/N 7359890) were processed from 8660 and 51B60 material representative of various

cleanliness grades, mechanical tests were conducted on specimens to ascertain tension, static torsion and fracture toughness properties.

Specimen blanks representative of various cleanliness levels were ultrasonically located and sectioned from billet and rolled bar stock. Specimen blanks were heat treated (quenched and tempered) to obtain a hardness of Rc50 in accord with specification requirements (MIL-S-45387A). The heat treat cycles for both material grades consisted of austenitizing at 1575°F (857C) for 1½ hours, oil quenching and tempering at 725°F (385C) 2 hours. The resultant hardness after temper was Rc 49 to Rc 50.

#### Tension Tests

Standard tension specimens (0.505 inch (1.28cm) diameter) were prepared and tested in accord with ASTM E-8. The test results obtained with specimens (8660) located from billet material are shown in Table VIII. Test results of specimens (8660) located from rolled bar stock are shown in Table IX. As can be noted, both materials show comparable ultimate and yield strengths with specimens sectioned from the billet stock. Specimens prepared from 8660 show a higher percent reduction of area for all cleanliness levels or grades. Tension properties for specimens sectioned from billet and bar stock are shown in Table IX and Table X. Again, it is noted that strength properties remain fairly consistent until large defects are encountered whereupon ductility is reduced to such a magnitude that specimen fracture

occurs prior to yielding. This condition is more prevalent with the 51B60 alloy.

#### Torsion Tests

Torsion yield strength of specimens prepared from 8660 billet stock is presented in Table XII. Results obtained from bar stock material are listed in Table XIII for the various cleanliness grades. The bar stock indicates a higher yield strength in contrast to the billet stock.

Torsion yield strength of 51B60 specimens prepared from billet stock are listed in Table XIV. Torsion yield strength data of bar stock is shown in Table XV. As can be noted, the 51B60 material shows higher torsional yield strength over 8660 material for the cleaner grades (A and B). At the lower ultrasonic cleanliness levels a deterioration of 51B60 material torsional strength is observed. A photograph which depicts several fractured torsion specimens is shown in Figure 5. Figures 6 and 7 show the sites and extent of surface cracks observed on torsion specimens examined by magnetic particle inspection prior to testing.

#### Fracture Toughness

Fracture toughness evaluations were conducted using fcsg Charpy specimens. The results obtained for 8660 material are listed in Table XVI. Fracture toughness results for 51B60 material are shown in Table XVII. The influence of material cleanliness on

fracture toughness is observed with both alloys. A lower fracture toughness with the 51B60 material would be anticipated and was observed. The results shown in Tables XVI and XVII were computed by mathematical formula developed under Contract No. DAAG46-69-C-0005 for calculating KIC using a fatigue cracked side-grooved Charpy specimen.

The mathematical formula is:

$$(K_{IC}/YS)^2 = 4.9 (W + 4.3) - 0.05$$
  
 $\frac{1}{YS \times 10^{-3}}$ 

Where: YS = Yield Strength

W = Impact Energy

All side grooves were 0.020 in. (.51mm) deep with an included angle of  $45^{\circ}$ . Fatigue crack depths of 0.025 to 0.030 inches (.635 to .762mm) were sought. However, the fatigue crack depth ranged from 0.015 to 0.290 inches (.38 to 7.37 mm) due to the high hardness level coupled with low toughness encountered with the specimens of higher defect severity. Therefore, KIC values were also calculated based on  $G_{IC}$  or W/A which corrects for the wide scatter in fatigue crack depth.

The formula for calculating  $K_{IC}$  by this procedure is

$$K_{IC} = (EW/.0841A)^{\frac{1}{2}}$$

Where E = Young's Modulus

A = Net cross-section area

W = Energy (in.-lbs.)

The average KIC values for all cleanliness grades were as follows:

	Maximum Value	Minimum Value	Mean Value	Std. Dev.
8660 (Bar)	84.6	68.9	74.3	3.14
8660 (Billet)	80.2	62.0	71.8	5.41
51B60 (Bar)	74.0	59.5	66.3	4.36
51B60 (Billet)	71.5	61.4	66.0	3.16
		$(ksi - in^{\frac{1}{2}})$		

In comparing mean values, the 8660 bar stock indicated a 12% increase in fracture toughness over 51B60 bar stock. The 8660 billet stock shows a 9% increase in fracture toughness strength over 51B60 billet stock.

#### CONCLUSIONS

Mechanical properties evaluation of 8660 and 51B60 which were ultrasonically inspected and rated for cleanliness in bar and billet condition indicated the following:

- 1. Tension specimens from bar and billet material of 8660 showed a reduction in ductility (% R.A.) of 30.7% and 82.4%, respectively. Ductility of 51B60 specimens (bar and billet) were reduced 100% between clean (Grade A) and severe levels (Grade E) of internal defects.
- 2. Torsion yield strength for 8660 bar material did not show any reduction for the various cleanliness grades. Ultimate torsion strength

was reduced 6%. Torsion yield strength of 51B60 bar specimens was reduced 25% and a 13% reduction in ultimate torsion strength.

- 3. The 3660 bar material had a higher (12%)
  mean fracture toughness value than the 51B60
  bar material.
- 4. In comparing very clean material (Grade A) for both steel alloys in bar form, 51B60 showed a 24% lower % R.A. for comparable ultimate and yield strength magnitudes, an 8% higher static torsion yield strength and a 5% lower static fracture toughness value.

#### RECOMMENDATIONS

Fatigue test results of the full size torsion bars for both steel chemistries at various cleanliness levels are needed before a complete recommendation can be made.

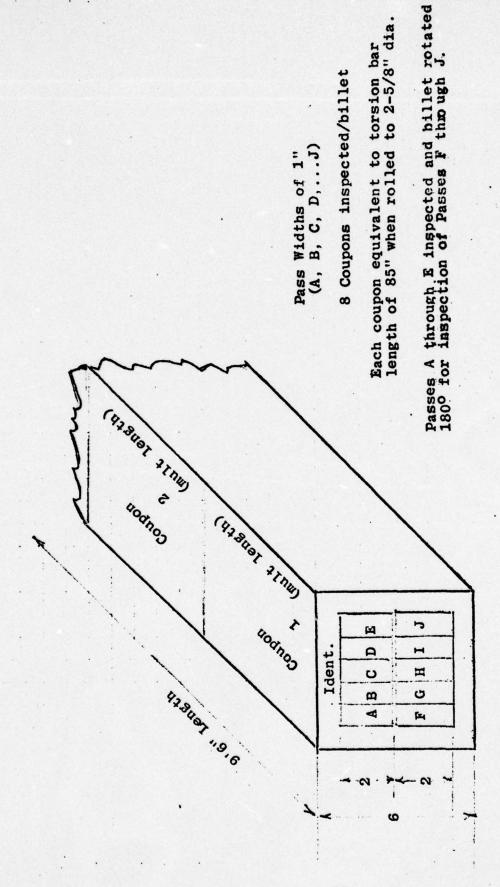


Figure 1 -- Zones and Method of Ultrasonic Inspection Coverage for 6" x 6" Billets

```
HEAT
                      OPERATOR
BILLET
                      DATE
COUPON
         B(")
PASS
        1" 7. 3"
GATE
GAIN SETTING 12 Da. P. FACT SET .
CATEG
             COUNT
                                       P. FACT.
                          FREQ
                                                         PROD
   1
   2
               63
                         .0008
                                          1.0
                                                         .0008
   3
            10794
                         . 1455
                                          1.6
                                                         .2358
   4
            35186
                         . 4744
                                        2.6
                                                        1.2430
   5
            19824
                         .2673
                                          4.2
                                                        1-1360
   ó
             6025
                                          6.9
                         .0812
                                                         .5597
             1618
                         .0218
                                         11.2
                                                         -2435
   8
              510
                                         18.1
                         .0069
                                                         .1243
   9
              108
                                        29.3
                         .0015
                                                         . Ø426
  10
               21
                         .0003
                                         47.4
                                                         .0134
  11
               15
                         .0002
                                         76.8
                                                         .0155
  12
. 13
  14
  15
  16
 TOTAL
            74164
STORED INDEX
                      .0
CALCD INDEX
```

Figure 2 -- Computer Print-out of Defect Magnitude, Count and Calculated Cleanliness Index Rating

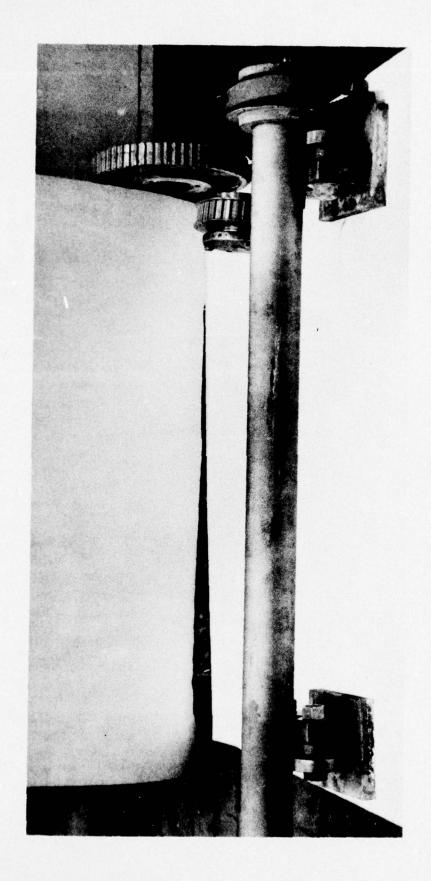


Figure 3 -- Support Fixture for Rotating Torsion Bar Stock in Ultrasonic Immersion Tank



Figure 4 -- Internal Defect Located Ultrasonically in Billet and Subsequently Machined to Position Defect Near the Surface

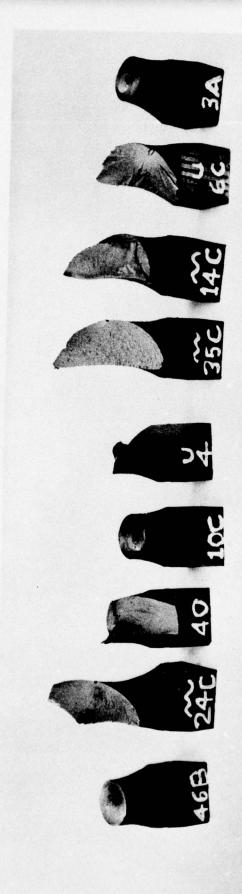


Figure 5 -- Fractured Torsion Bar Specimens

Spec. No. 3 8660, Cleanliness Grade A (bar) Spec. No. 46 51B60, Cleanliness Grade A (bar) Spec. No. 27 8660, Cleanliness Grade E (billet) Spec. No. 35 51B60, Cleanliness Grade B (billet) ф. c. b.

### POSITION OF CRACKE IN CHACKED STAPLES

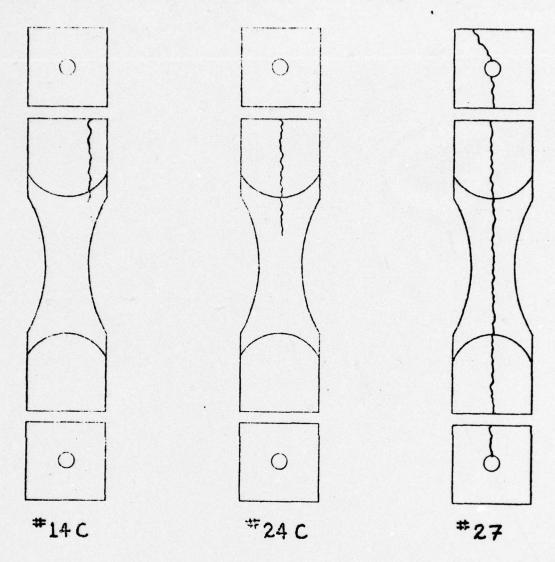


Figure 6 -- Sites of Surface Cracks
which Propagated from Internal
Defects Located Ultrasonically
in Billet Stock

### POSITION OF CRACKS IN CRACKED SAMPLES

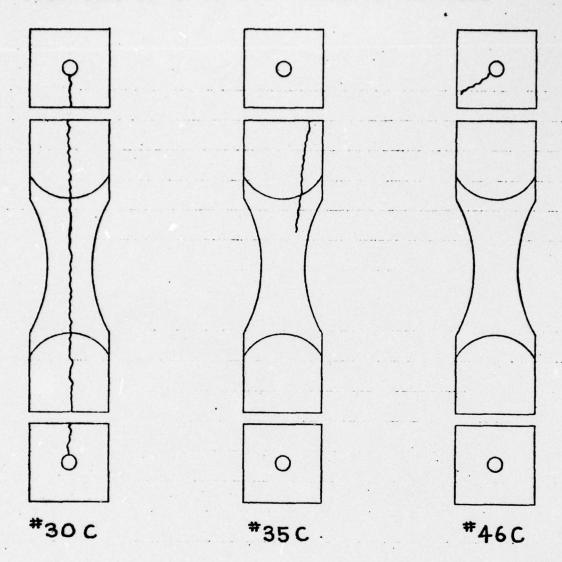


Figure 7 -- Sites of Surface Cracks
which Propagated from Internal
Defects Located Ultrasonically

(30C & 35C - Billet, 46C - Bar Stock)

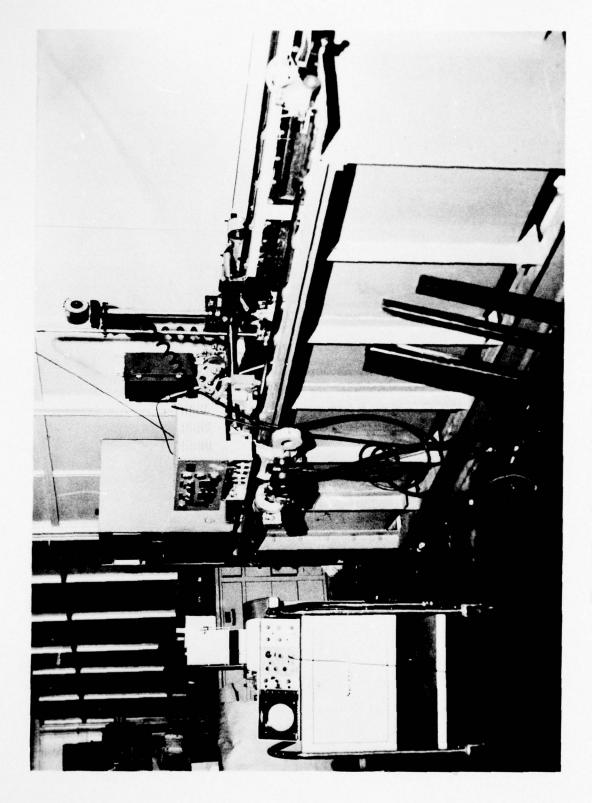


Figure 8 -- Automated Computerized Ultrasonic Cleanliness Rating System

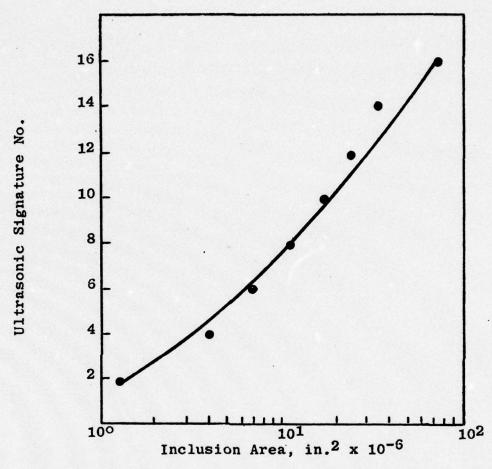


Figure 9 - Ultrasonic Inclusion Category
Versus Inclusion Area as
Measured by Light Microscopy

TABLE I

#### 8660

Billet #	Mult Length #	Grade	Billet #	Mult Length #	Grade
12	1 2 3 4 5 6 7 8	A C A D D C	27	1 2 3 4 5 6 7 8	D C A A E E
8	1 2 3 4 5 6 7 8	D B A B A	7	1 2 3 4 5 6 7 8	A A A B B B
6	1 ' 2 ' 3 ' 4 ' 5 ' 6 ' 7 ' 8	C B D C C C D	14	1 2 3 4 5 6 7	B B B B B
9	1 2 3 4 5 6 7 8	D B B B C B	11	1 2 3 4 5 6 7	A A A A C C
5	1 2 3 4 5 6 7 8	e e e e e	2	1 2 3 4 5 6 7 8	C C D A A A D

TABLE II

#### 8660

Billet #	Mult Length #	Grade	Billet #	Mult Length #	Grade
22	1 2 3 4 5 6 7 8	C B B D A A	10	1 2 3 4 5 6 7 8	A A A A A A
13	1 2 3 4 5 6 7 8	C A A A B B	40	1 2 3 4 5 6 7 8	C A A A C B A
37	1 2 3 4 5 6 7 8	B D C C B C B	33	1 2 3 4 5 6 7 8	D D D D E D
31	1 2 3 4 5 6 7 8	B D B D A B	30	1 2 3 4 5 6 7 8	B B B B B
14	1 2 3 4 5 6 7	C B C C D B			
	8	Ā 2	3		

TABLE III

Billet # 15	Mult Length #  1 2 3 4 5 6 7 8	Grade A B B A A A B	<u>Billet #</u> 34	Mult Length #  1 2 3 4 5 6 7 8	Grade D C C C B C C D
26	1 2 3 4 5 6 7 8	A B A C A A B	20	1 2 3 4 5 6 7 8	A B B C A B
32	1· 2 3 4 5 6 7 8	A A A A A B B	36	. 1 2 3 4 5 6 7 8	C C D E B B
38	1 2 3 4 5 6 7 8	A A A B A A	21	1 2 3 4 5 6 7 8	B D B D A A

#### TABLE IV

# ULTRASONIC CLEANLINESS RATING (GRADE LEVEL) OF 6 IN X 6 IN BILLET MULT LENGTHS

Billet #	Mult Length #	Grade	Billet #	Mult Length #	Grade
23	1 2 3 4 5 6 7 8	A A A A A A	4	1 2 3 4 5 6 7 8	A A B A B A
24	1 2 3 4 5 6 7 8	A A A A A A	29	1 2 3 4 5 6 7 8	C C B B A A
35	`1 2 3 4 5 6 7 8	A A A B B B	16	. 1 2 3 4 5 6 7 8	A C C C C A A
28	1 2 3 4 5 6 7 8	A A C C C A A	25	1 2 3 4 5 6 7 8	B B B B G E
18	1 2 3 4 5 6 7	B B B C B C	3	1 2 3 4 5 6 7 8	A B C C B C
	8	C 2	5	8	В

TABLE V

Billet #	Mult Length #	Grade	Billet #	Mult Length #	Grade
39	1	B B			
	3	Č			
	<b>4</b> 5	A A			
	5 7	C A			
	8	A			

TABLE VI

### BAR STOCK (2-5/8 INCH DIA.) MACHINED FROM 6 INCH X 6 INCH BILLETS

8	6	6	0

Identification			
A			
r			
В			
J			
E			

Grade	Identification			
I	G			
II	H			
III	D			
IV	K			
V	C			

#### TABLE VII

### ULTRASONIC RATING (GRADE LEVEL) OF 2-5/8 INCH DIAMETER ROLLED BARS

#### 8660

Grade	Bar Identification					
A	9, 1, 20, 23, 18, 19					
В	5, 2, 24, 12, 25, 13					
С	11, 7, 14, 16, 17, 10, 26					
D	21, 32, 39, 34, 37, 36					
E	30, 31, 33, 29, 35, 38					

Grade		Bar Identification						
A	84,	56,	47,	77,	80,	82		
В	62,	71,	83,	55,	69,	78		
C	67,	87,	81,	68,	49,	72		
<b>D</b> .	61,	85,	86,	79,	41,	50		
E	70,	53,	88,	<b>6</b> 3,	43,	73,	42	

TABLE VIII

TENSION PROPERTIES (0.505 INCH DIA. SPECIMEN)

SECTIONED FROM 6 IN. X 6 IN. BILLETS

Ultrasonic	Inclusion	UTS,	Ys	% Elong.	% R.A.
Grade	Category	Ksi	Ksi	(2 in.)	
A	3	256.8	230.5	9.0	32.4
	3	256.4	228.1	8.5	29.6
В	5	256.7	229.4	8.5	32.5
	6	256.8	231.0	8.5	31.4
С	8	255.8	229.7	9.0	29.1
	10	264.7	233.3	8.5	29.7
D	13	257.8	229.6	6.0	15.4
	14	264.5	236.0	3.5	7.4
E	16	260.5	235.3	1.5	4.9
	16	248.6	235.5	1.5	3.7

TABLE IX

TENSION PROPERTIES (0.505 INCH DIA. SPECIMEN)

SECTIONED FROM 2-5/8 INCH DIA. BAR

Ultrasonic	UTS,	YS,	% Elong.	%
Grade	Ksi	Ksi	(in 2 Inch)	R.A.
A	257.8	231.0	9.0	35.9
	261.6	235.6	9.0	35.0
В	258.6	230.1	8.5	30.5
	258.0	230.4	8.0	28.5
С	259.9	232.8	8.5	28.2
	259.1	232.6	8.5	27.9
D	256.8	230.9	8.0	27.5
	259.9	234.4	6.5	23.7
E	258.1	232.0	5.0	13.0
	259.4	230.2	5.5	11.9
	259.9	232.8	3.0	7.8

TABLE X

TENSION PROPERTIES (0.505 INCH. DIA. SPECIMEN)

SECTIONED FROM 6 IN. X 6 IN. BILLETS

A	3		257.1	234.3	8.5	29.2
	4		255.7	232.0	8.0	27.0
В	5 8		265.3	236.7	8.0	24.4
	8		258.6	235.3	1.0	2.4
c	9		263.8	236.4	2.0	3.9
	10		245.4	238.9	1.0	4.0
D	12		256.0	236.2	5.5	7.4
	14		257.1	234.8	1.0	2.5
E	16		228.2		0	0
	16	٠	233.0		ŏ	ŏ

TABLE XI

### TENSION PROPERTIES (0.505 INCH DIA. SPECIMEN) SECTIONED FROM 2-5/8 INCH DIA. BAR

Ultrasonic	UTS,	YS,	% Elong. (In 2 Inch)	%
Grade	Ksi	Ksi		R.A.
Α .	264.6	238.2	8.5	28.8
	264.3	235.7	7.5	28.3
В	260.2	233.5	8.5	27.2
	264.5	238.9	7.0	24.0
c	277.4	246.4	6.5	22.5
	256.6	221.0	2.0	5.1
D	259.8 208.8	233.7	2.5 0 (cracked from	3.1 0
E	200.2		0 (cracked from	0
	224.7		0 (cracked from	0

TABLE XII

# STATIC TORSION STRENGTH OF BILLET STOCK (6" x 6")

Ultrasonic Grade	Torsion Yield Strength, In.Lbs.	Torsion Ultimate Strength, In.Lbs.
A	101,200	135,300
В	61,600*	61,600
С	107,800	138,600
D	110,000	135,300
E	77,000*	78,100

<sup>\*</sup>Ruptured prior to yield

#### TABLE XIII

# STATIC TORSION STRENGTH OF BAR STOCK (2-5/8 INCH DIA.)

Ultrasonic Grade	Torsion Yield Strength, In.Lbs.	Torsion Ultimate Strength, In.Lbs.
A	116,600	149,600
В	116,600	144,100
С	116,600	147,400
D	116,600	141,900
E	116,600	140,800

## TABLE XIV

## STATIC TORSION STRENGTH OF BILLET STOCK (6" x 6")

Ultrasonic Grade	Torsion Yield Strength, In.Lbs.	Torsion Ultimate Strength, In.Lbs.
A	119,700	146,000
В	112,200	137,500
c	102,300	119,900
D	93,500*	93,500
E	66,000*	66,000

<sup>\*</sup>Ruptured prior to yield

#### TABLE XV

#### STATIC TORSION STRENGTH OF BAR STOCK (2-5/8 IN.DIA.)

Ultrasonic Grade	Torsion Yield Strength, In.Lbs.	Torsion Ultimate Strength, In.Lbs.
A	119,900	149,000
В	126,500	151,800
C	114,400	145,200
D	102,300	148,500
E	101,000	134,200

#### TABLE XVI

# ROOM TEMPERATURE FRACTURE TOUGHNESS (KIC) AS MEASURED BY FCSG CHARPY SPECIMENS

## 8660 (Billet)

Ultrasonic Grade	K <sub>IC, Ksi In</sub> <sup>1</sup>
A	76.5, 85.2, 80.4, 82.4
В	78.4, 81.3, 79.7, 80.2
C	74.7, 83.6, 81.9, 78.8
D	88.6, 71.5, 69.7, 80.1
E	62.4, 48.9, 70.4, 66.0

#### 8660 (Bar)

Ultrasonic Grade	K <sub>IC</sub> , Ksi -In <sup>2</sup>			
A	82.4, 83.5, 87.4, 79.2			
В	78.3, 80.5, 79.3, 83.1			
C	76.2, 81.3, 82.5, 79.1			
D	80.3, 75.6, 77.8, 73.6			
E	68.3, 74.5, 66.7, 76.5			

#### TABLE XVII

#### ROOM TEMPERATURE FRACTURE TOUGHNESS AS MEASURED BY FCSG CHARPY SPECIMENS

## 51B60 (Billet)

Ultrasonic Grade	K <sub>IC</sub> , Ksi, In <sup>1</sup> / <sub>2</sub>
A	68.3, 66.4, 62.8, 64.9
В	68.7, 72.3, 76.6, 65.1
С	58.2, 55.1, 61.7, 63.4
D	60.5, 52.3, 58.7, 48.2
E	44.3, 49.2, 34.8, 46.5
	51B60 (Bar)
A	72.4, 69.8, 81.4, 84.2
В	73.1, 62.9, 67.3, 73.6
C	80.3, 71.4, 60.9, 58.3

D

E

63.7, 66.4, 69.1, 52.8

59.2, 54.6, 57.3, 41.8

## DISTRIBUTION LIST

ADDRESSEE	NO. OF COPIES
Commander U.S. Army Armament Command ATTN: DRSAR-Q, Mr. J. Obren DRSAR-QAE, Mr. D. Spears DRSAR-PPW-IR, Mr. E. Case Rock Island, IL 61201	1 1
Commander Rock Island Arsenal ATTN: SARRI-R, Mr. W. Kisner SARRI-LEQ, Mr. J. Hausman SARRI-R, Mr. W. McHenry Rock Island, IL 61201	1
Commander Watervliet Arsenal ATTN: SARWV-PPI, Mr. L. A. Jette SARWV-QA, Mr. J. Miller SARWV-QAS, Mr. J. Monagnan Watervliet, NY 12189	1 1
Commander Picatinny Arsenal ATTN: SARPA-QA-X, Mr. Fitzsimmons SARPA-VC 2, Mr. T. M. Roach SARPA-QA-T-T, Mr. D. Stein Mr. M. McAloon Dover, NJ 07801	1 1 1
Commander Frankford Arsenal ATTN: SARFA-QAF-R. Mr. J. Braverman SARFA-K3300, Mr. G. Norwitz SARFA-K-4000, Mr. H. Sokolowski SARFA-QAA-Q, Mr. J. Barr Philadelphia, PA 19137	
Commander Edgewood Arsenal ATTN: Mr. W. E. Montanary, C, Program Division SAREA-PATM, Dr. W. J. Maurits Aberdeen Proving Ground, MD 21005	}

ADDRESSEE	NO. OF COPIES
Commander U.S. Army Electronics Command ATTN: DRSEL-QM DRSEL-PAE, Mr. S. Alster Fort Monmouth, NJ 07703	;
Commander U.S. Army Missile Command ATTN: DRSMI-QLC, Mr. Kenneth E. Parr Mr. Knowlen Knowles Redstone Arsenal, AL 35809	1
Commander Harry Diamond Laboratories ATTN: DRXDO-PP, Mr. Hoke DRXDO-EDE, Mr. Benjamin F. Willis 2800 Powder Mill Road Adelphi, MD 20783	1
Commander U.S. Army Tank-Automotive Research & Development Command ATTN: DRDTA-RKA DRDTA-JE, Mr. Gamache Warren, Michigan 48090	24 1
Commander U.S. Army Tank-Automotive Materiel Readiness Command ATTN: DRSTA-QA UNSTA-G Warren, MI 48090	1
Commander U.S. Army Aviation Systems Command ATTN: DRSAV-L DRSAV-LE, Mr. J. T. Conroy P. O. Box 209 St. Louis, MO 63166	;
Commander U.S. Army Test & Evaluation Command ATTN: DRSTE-TAA DRSTE-TO-P, Mr. A. Baldridge DRSTE-ME, Mr. S. Wise Aberdeen Proving Ground, MD 21005	

<u>ADDRESSEE</u>	NO. OF COPIES
Commander Aberdeen Proving Ground ATTN: STEAP-MT-M STEAP-MT-G, Mr. R. L. Huddleston Aberdeen Proving Ground, MD 21005	1
Commander Dugway Proving Ground ATTN: STEDP-PC Dugway, UT 84022	1
Commander Jefferson Proving Ground ATTN: STEJP-TD Madison, IN 47250	1
Commander U.S. Army Tropic Test Center ATTN: STETC-TD-T, Drawer 942 Fort Clayton, CZ	1
Commander U.S. Army White Sands Missile Range ATTN: STEWS-TE-PM White Sands Missile Range, NH 88002	1
Commander Yuma Proving Ground ATTN: STEYP-MP, Mr. Uhl Yuma, AZ 85364	1
Commander U.S. Army Troop Support Command ATTN: DRSTS-Q 4300 Goodfellow Boulevard St. Louis, MO 63120	1 ,
Commander U.S. Army Mobility Equipment Research & Development Command ATTN: DRXFB-QA, Mr. J. K. Mauzy DRXFB-EM, Mr. S. Levine DRXFB-RM, Mr. E. York Fort Belvoir, VA 22060	
Commander U.S. Army Natick R&D Command ATTN: DRXNM-EM, Mr. S. Werkowski DRXNM-GE, Mr. M. Budnick Kansas Street Hatick MA 01762	;

ADDRESSEE	NO. OF COPIES
Uirector Army Materials and Mechanics Research Center ATTN: DRXMR-CT DRXMR-MI, Mr. G. A. Darcy DRXMR-RA, Mr. F. Valente DRXMR-EM, Mr. T. DeSisto DRXMR-X, Dr. E. S. Wright DRXMR-PP, Mr. J. O'Connor Mr. M. Cheney Watertown, MA 02172	1 1 1 1 1
PM, Selected Ammunition Picatinny Arsenal Dover, NJ 07801	1
PM, Aircraft Survivability Equipment U.S. Army Aviation Systems Command St. Louis, MO 63166	1
PM, CH-47 Modernization Program U.S. Army Aviation Systems Command St. Louis, MO 63166	1
PM, COBRA U.S. Army Aviation Systems Command St. Louis, MO 63166	1
PM, Iranian Aircraft Program U.S. Army Aviation Systems Command St. Louis, MO 63166	
PM, Heavy Lift Helicopter U.S. Army Aviation Systems Command St. Louis, MO 63166	1
PM, Army Tactical Communications Systems U.S. Army Electronics Command Ft. Monmouth, NJ 07703	1
PM, Army Tactical Data Systems U.S. Army Electronics Command Ft. Monmouth, NJ 07703	1
PM, Mortar/Artillery Locating Radars U.S. Army Electronics Command Ft. Monmouth, NJ 07703	1

ADURESSEE		NO. OF COPIES
PM, Multi-Service Communications Sys U.S. Army Electronics Command	tems	
Ft. Monmouth, NJ 07703		1
PM, Navigation Control Systems U.S. Army Electronics Command Building 2525		
Ft. Monmouth, NJ 07703		1
PM, Remotely Monitored Battlefield S U.S. Army Electronics Command	ensor System	
Ft. Monmouth, NJ 07703		1
PM, Dragon		
U.S. Army Missile Command Redstone Arsenal, AL 35809		1
PM, Hawk		
U.S. Army Missile Command Redstone Arsenal, AL 35809		1
PM, HELLFIRE Missile System		
U.S. Army Missile Command Redstone Arsenal, AL 35809		1
PM, LANCE		
U.S. Army Missile Command		•
Redstone Arsenal, AL 35809		
PM, Pershing		
U.S. Army Missile Command Redstone Arsenal, AL 35809		1
PM, Precision Laser Designators		
U.S. Army Missile Command		
Redstone Arsenal, AL 35809		. 1
PM, 2.75" Rocket System		
U.S. Army Missile Command		
Redstone Arsenal, AL 35809		, 1
PM, TOW		
U.S. Army Missile Command		

ADDRESSEE	NO. OF
PM, 1-1/4 Ton Commercial Truck Systems U.S. Army Tank-Automotive Materiel Readiness Command MAMP, Bldg. 2 Warren, Michigan 48090	1
PM, FAMECE Ft. Belvoir, VA 22060	1
PM, Heavy Equipment Transporter U.S. Army Tank-Automotive Materiel Rediness Command Warren, Michigan 48090	-1
PM, M60 Tank Development 28150 Dequindre Warren, MI 48092	1.
PH, Advanced Attack Helicopter U.S. Army Aviation Systems Command St. Louis, MO 63166	1
PM, Mechanized Infantry Combat Vehicle U.S. Army Tank-Automotive Materiel Rediness Command 28150 Dequindre Warren, MI 48092	1
PM, Mobile Electric Power 7500 Backlick Road Springfield, VA 22150	1
PM, Munitions Production Base Modernization and Expansion Picatinny Arsenal Dover, NJ 07801	1
PM, PATRIOT U.S. Army Missile Command Redstone Arsenal, AL 35809	1
PM, Satellite Communications Ft. Monmouth, NJ 07703	1
PM, SANG ATTN: AMCPM-NG 5001 Eisenhower Avenue Alexandria, VA 22333	1 1
PM, Training Devices Naval Training Equipment Center Orlando, FL 32813	1

ADDRESSEE	NO. OF COPIES
PM, Utility Tactical Transport Aircraft System U.S. Army Aviation Systems Command St. Louis, MO 63166	1
PM, XM-1 Tank System 28150 Dequindre Warren, MI 48092	1
PM, Stinger U.S. Army Missile Command Redstone Arsenal, AL 35809	1
PM, Advanced Scout Helicopter U.S. Army Aviation Systems Command St. Louis, MO 63166	1
PM, Special Electronic Mission Aircraft (SEMA) Materiel Rediness U.S. Army Aviaition Systems Command St. Louis, MO 63166	1
PM, Single Channel Ground and Airborne Radio Subsystem U.S. Army Electronics Command Ft. Monmouth, NJ 07703	1
PM, Signal Intelligence/Electronic Warfare (SIGINT/EW) Materiel Readiness U.S. Army Electronics Command Ft. Monmouth, NJ 07703	1
PM, High Energy Laser System U.S. Army Missile Command Redstone Arsenal, AL 35809	1
PM, KUWAIT U.S. Army Missile Command Redstone Arsenal, AL 35809	1
PM, US ROLAND U.S. Army Missile Command Redstone Arsenal, AL 35809	1
PM, VIPER U.S. Army Missile Command Redstone Arsenal. AL 35809	1

ADDRESSEE	NO. OF
PM, Improved TOW Vehicle (ITV) U.S. Army Tank-Automotive R&D Command Warren, MI 48090	1
PM, M60 Tank Production 28150 Dequindre Warren, MI 48092	1
PM, Amphibians and Watercraft U.S. Army Troop Support Command 5300 Goodfellow Boulevard St. Louis, MO 63120	1
PM, Army Container Oriented Distribution System U.S. Army Material Development & Readiness Command 5001 Eisenhower Avenue Alexandria, VA 22333	1
Pi4, Chemical Demilitarization and Installation Restoration Aberdeen Proving Ground, MD 21010	1
PM, DCS (Army) Communications Systems Ft. Monmouth, NJ 07703	1
PM, Nuclear Munitions Picatinny Arsenal Dover, NJ 07801	1
PM, Automatic Test Support Systems U.S. Army Electronic Command Ft. Monmouth, NJ 07703	1
PM, FIREFINDER U.S. Army Electronics Command Ft. Monmouth, NJ 07703	1
PM, M113/M113Al Family of Vehicle Readiness U.S. Army Tank-Automotive Materiel Readiness Command MAMP, Bldg. 2 Warren, MI 48090	1
PM, SMOKE Aberdeen Proving Ground, MD 21005	1
PM, Army Gun Air Defense Systems U.S. Army Armament Command Rock Island, IL 61201	1

ADDRESSEE	COPIES
PM, Cannon Artillery Weapons Systems Picatinny Arsenal Dover, NJ 07801	1
PM, M110E2 8" Howitzer U.S. Army Armament Command Rock Island, IL 61201	1
PM, Safeguard Munitions Picatinny Arsenal Dover, NJ 07801	1
Defense Documentation Center ATTN: DDC-TC Cameron Station 5010 Duke Street Alexandria, VA 22314	12

REPORT DOCUMENTATION P	PAGE	READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO.	. 3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle)		5. TYPE OF REPORT & PERIOD COVERED
Establishment of Ultrasonic Inclusion Rating Method for Torsion Bar Spring		Final
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(e)		S. CONTRACT OR GRANT NUMBER(+)
Clarence J. Carter and Raymond A. Cellitti		DAAE+07-75-C-0088
9. PERFORMING ORGANIZATION NAME AND ADDRESS		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
International Harvester Comp	oany	A Committee of the Comm
Manufacturing Research Hinsdale Illinois 60521 11. CONTROLLING OFFICE NAME AND ADDRESS		12. REPORT DATE
U.S. Army Tank - Automotive	Research	August, 1977
and Development Command Warren, Michigan 48090		13. NUMBE OF PAGES
14. MONITORING AGENCY NAME & ADDRESS(If different	from Controlling Office)	18. SECURITY CLASS. (of this report)
		Unclassified
		154. DECLASSIFICATION/DOWNGRADING
Approved for public release:	distribution	n unlimited

17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)

18. SUPPLEMENTARY NOTES

19. KEY WORDS (Continue on reverse side if necessary and identify by block number)

Torsion spring material - Ultrasonic evaluation Variable steel cleanliness - Torsion properties Tension properties

20. ABSTRACT (Continue on reverse side if necessary and identify by block number)

Torsion spring material steel billets of 8660 and 51B60 were ultrasonically evaluated and graded for internal cleanliness. The billets were rolled to bar stock (2-5/8 inch dia.) reinspected ultrasonically and processed into torsion bars (P/N 7359890) forsubsequent testing at TARADCOM. Standard test specimens were prepared and tested from bar and billet stock. Tension tests indicated that reduction (>2:1) in (continued on reverse)

DD 1 JAN 73 1473 EDITION OF I NOV 65 IS OBSOLETE

#### Abstract Cont'd.

billets containing inclusion areas of ultrasonic signature No. 10. Inclusion area of 8660 bar stock (6.6:1 reduction from billet cross section) showed a 1.25:1 reduction in ductility for inclusion areas of category 10. Billet material of 51B60 indicated a 7:1 reduction in ductility for category 10 inclusion and bar stock indicated a 2:1 average reduction of ductility. Torsion test of specimens from billet stock for both alloy grades indicated susceptibility to crack occurrence from internal defects. Torsion yield strength of 51B60 showed a decline of 17.5% between extreme cleanliness grades. No difference in torsion yield strength was noted with 8660 which is attributed to a higher degree of ductility at high cleanliness severity levels. Fracture toughness ( $K_{IC}$ ) was comparable for both alloy grades. Ultrasonic category 10 is equivalent to  $2 \times 10^{-5}$  in 2.